		NTSB ID: CHI08IA182		Aircraft Registration Number: N804ME	
		Occurrence Date: 07/07/2008		Most Critical Injury: None	
		Occurrence Type: Incident		Investigated By: NTSB	
Location/Time					
Nearest City/Place St. Louis	State MO	Zip Code 63134	Local Time 0845	Time Zone CDT	
Airport Proximity: On Airport/Airstrip		Distance From Landing Facility:			
Aircraft Information Summary					
Aircraft Manufacturer MCDONNELL DOUGLAS		Model/Series MD-81		Type of Aircraft Airplane	
Revenue Sightseeing Flight: No			Air Medical Transport Flight: No		
Narrative					
<p>Brief narrative statement of facts, conditions and circumstances pertinent to the accident/incident:</p> <p>HISTORY OF FLIGHT</p> <p>On July 7, 2008, at approximately 0845 central daylight time, a McDonnell Douglas MD-81, N804ME, operated as Midwest Airlines Flight 8663, experienced a tailcone evacuation slide inflation shortly after takeoff from Chicago Midway International Airport (KMDW), Chicago, Illinois. Visual meteorological conditions prevailed at the time of the event. The charter flight was operating under the provisions of 14 Code of Federal Regulations (CFR) Part 121 on an instrument flight plan.</p> <p>There were no injuries to the 2 flight crew members, 4 flight attendants, 2 airline representatives, and 43 passengers. The flight was en route to Charlotte-Douglas International Airport (KCLT), Charlotte, North Carolina, when the evacuation slide inflated. The airplane diverted to Lambert-St. Louis International Airport (KSTL), St. Louis, Missouri, and made an uneventful landing at 0930.</p> <p>Flight crew statements indicated that they did not hear the slide inflate in flight, nor did an airline mechanic who was seated in the rear of the airplane. The captain reported that after liftoff the airplane's pitch continued to increase without a corresponding flight control input. The airplane's pitch reached 20-25 degrees nose up before he regained control using control column and stabilizer pitch trim inputs. The flight crew noted that the pitch control pressure required to level the airplane was "higher than normal."</p> <p>After the incident, the flight crew consulted with the airline's maintenance staff, in addition to completing the abnormal checklist procedures. The corrective actions taken by the flight crew were ineffective in reducing or eliminating the restriction in the pitch control system. Consequently, they elected to divert to KSTL instead of continuing to KCLT. The captain noted that normal flight control pressures returned during cruise descent, as the airplane passed through 15,000 feet mean sea level (msl). According to the flight crew, no additional flight control restrictions or anomalies were encountered during the remainder of the flight.</p> <p>PERSONNEL INFORMATION</p> <p>According to Federal Aviation Administration (FAA) records, the captain, age 50, held an airline transport pilot certificate with airplane single and multiengine land ratings. The airplane single-engine land rating was limited to commercial privileges only. He also held a flight instructor certificate with single and multi-engine airplane, and instrument airplane ratings. He was type-rated in the Cessna Citation, Learjet, and McDonnell Douglas DC-9 airplanes. His last aviation medical examination was completed on June 18, 2008, when he was issued a first-class medical certificate with the limitation that he have corrective lenses available for near vision. At the time of the medical examination, the pilot reported having 15,014 hours of flight experience. A search of FAA records showed no accident, incident, enforcement or disciplinary actions.</p>					
<div>FACTUAL REPORT - AVIATION</div> <div>Page 1</div>					

National Transportation Safety Board

FACTUAL REPORT**AVIATION**

NTSB ID: CHI08IA182

Occurrence Date: 07/07/2008

Occurrence Type: Incident

Narrative (Continued)

The airline hired the captain on January 3, 1990, to fly variants of the Douglas DC-9, McDonnell Douglas MD-80, and Boeing 717 airplanes. He had flown 850 hours during the previous 12 months, 413 hours during the prior 6 months, 200 hours during the past 90 days, and 60 hours during previous month. He had flown about 0.4 hours during the 24 hour period before the incident flight. His last regulatory checkride was completed on June 9, 2008, in the same make/model as the incident airplane.

According to FAA records, the first officer, age 42, held an airline transport pilot certificate with airplane single and multiengine land ratings. The airplane single-engine land rating was limited to commercial privileges only. He also held a flight instructor certificate with single and multi-engine airplane, and instrument airplane ratings. He was type-rated in the McDonnell Douglas DC-9, Gulfstream G-IV, Learjet model 60, Saab-Fairchild model 340, and Boeing models 737, 757, and 767 airplanes. His last aviation medical examination was completed on September 28, 2007, when he was issued a first-class medical certificate with no restrictions or limitations. At the time of the medical examination, the pilot reported having 6,400 hours of flight experience. A search of FAA records showed no accident, incident, enforcement or disciplinary actions.

The airline hired the first officer on August 21, 2000, to fly variants of the Douglas DC-9, McDonnell Douglas MD-80, and Boeing 717 airplanes. He had flown 603 hours during the previous 12 months, 282 hours during the prior 6 months, 148 hours during the past 90 days, and 47 hours during previous month. He had flown about 0.4 hours during the 24 hour period before the incident flight.

His last regulatory checkride was completed on August 13, 2007, in the same make/model as the incident airplane.


AIRCRAFT INFORMATION

The MD-81 is a low-wing, twin engine, 14 CFR Part 25 certified transport-category airplane. The MD-81, which the FAA certified in 1981, was derived from earlier DC-9 models. As a result, much of the MD-81's structure and many of its systems, components, and installations are similar to earlier DC-9 models. According to Boeing, the first DC-9 airplane entered service in December 1965; the final DC-9 airplane entered service in October 1982. The MD-80 series, including the MD-81, -82, -83, -87 and -88 were in production through 1999. The DC-9 family of airplanes also includes the McDonnell Douglas MD-90 and Boeing 717 series airplanes.

The incident airplane, N804ME, an MD-81, serial number (s/n) 48030, was manufactured in 1981 and was registered to Midwest Airlines on September 23, 1998. The airplane was added to the airline's operating certificate on April 23, 1999. According to airline records, the airplane had accumulated about 46,844 total hours of operation at the time of the incident. The airplane was configured for charter operations and seated a maximum of 82 passengers, in addition to the 2 flight crew and 5 cabin crew members.

The incident airplane was equipped with two Pratt & Whitney JT8D-217C turbofan engines, each producing 20,000 lbs of thrust. Airline records indicated that the left engine, s/n 725625, had operated about 28,089 hours since new and 18,447 hours since its last overhaul. The right engine, s/n 718459, had operated about 34,384 hours since new and 8,528 hours since its last overhaul.

The airplane's tailcone is attached to the aft end of the fuselage and can be jettisoned to provide an opening for an emergency exit. This exit is accessible from the passenger compartment through the aft bulkhead pressure door and aft accessory compartment. The tailcone can be released either from inside or outside the aircraft. A mechanism is integrated into the aft bulkhead door, that when armed will jettison the tailcone and initiate the evacuation slide deployment. The tailcone falls away from the aft fuselage, and an attached lanyard pulls open the evacuation slide cover. This in turn rotates the slide pack aft and a second lanyard triggers the inflation cylinder which inflates the slide.

 National Transportation Safety Board FACTUAL REPORT AVIATION	NTSB ID: CHI08IA182
	Occurrence Date: 07/07/2008
	Occurrence Type: Incident

Narrative (Continued)

The tailcone evacuation slide (p/n 100503-117 Rev. J, s/n PAI058) was installed on December 10, 2007. Since its installation, no logbook discrepancies were noted for the evacuation slide. The airline's maintenance program called for a general visual inspection (service check) of the tailcone evacuation slide area every 99 flight hours. The last service check occurred on June 5, 2008, at which time no anomalies were noted with the slide installation. A less frequent operations (phase) check of the inflation cylinder pressure was last completed on June 20, 2008, without any significant findings.

METEOROLOGICAL INFORMATION

The closest weather station to the incident site was at the departure airport. The Chicago Midway International Airport (KMDW) was equipped with an automated surface observing system (ASOS).

At 0851, the KMDW ASOS reported the following weather conditions: Wind 230 degrees true at 10 knots, gusting 15 knots; visibility 10 miles; scattered clouds at 8,500 feet above ground level (agl), broken ceilings at 15,000 and 20,000 feet agl, and an overcast ceiling at 25,000 feet agl; temperature 26 degrees Celsius; dew point 21 degrees Celsius; altimeter setting 29.95 inches of mercury. The weather report indicated there were moderate rain showers in the distant west.

FLIGHT RECORDERS

The incident airplane was equipped with a Fairchild Model A100S Cockpit Voice Recorder (CVR), s/n 00781U. The CVR showed no signs of damage and was sent to the Safety Board's laboratory in Washington, DC, for readout and evaluation. The CVR did not contain any relevant data from the incident flight and was not transcribed.

The incident airplane was equipped with an L-3 Communications Fairchild Model F1000 Flight Data Recorder (FDR), s/n 00442, which recorded airplane flight information in a digital format using solid-state memory. The FDR showed no evidence of damage after removal from the incident airplane and was sent to the Safety Board's laboratory for readout and evaluation.

On the incident flight, the maximum pitch angle during initial rotation was 16.3 degrees with a maximum pitch rate of 3.5 degrees per second and an average pitch rate of 1.4 degrees per second. The maximum pitch seen during the takeoff and initial climb was 26.8 degrees. According to Boeing, typical pitch angles during initial climb are between 16-20 degrees, with occasional flights reaching 25 degrees. Typical rotation rates are approximately 3 degrees per second.

Inertial calculations were performed using FDR data from the incident flight in order to determine if the airplane encountered sufficient accelerations to have allowed an unsecured slide container to rotate open about its hinge line. The results indicated that during takeoff rotation and initial climb there were inertial loads of sufficient magnitude and duration to allow an unsecured slide cover to rotate open and initiate slide inflation. Prior to the incident flight, the airplane had flown 15 flight legs since the last service check of the tailcone evacuation slide. The same inertial calculations for rotation and initial climb indicated that the airplane had experienced loads of similar magnitude, but were of insufficient duration to result in slide inflation.

WRECKAGE AND IMPACT INFORMATION

Post-flight inspection of the airplane confirmed an in-flight inflation of the evacuation slide within the tailcone. Upon arrival on-scene, Safety Board investigators found the deflated slide lying in and around its cover. The slide cover was overturned immediately aft of its normal location at the end of the walkway. The slide's inflation cylinder was empty and lying inside the slide cover. The slide cover and base, including the hinges, forward tie-down straps, deployment

National Transportation Safety Board

FACTUAL REPORT**AVIATION**

NTSB ID: CHI08IA182

Occurrence Date: 07/07/2008

Occurrence Type: Incident

Narrative (Continued)

lanyard assembly, and floor mounting hardware were undamaged. A bracket that secured one of the walkway railings to an overhead structural support had fractured. The unsecured railing and an inflated slide may have impinged on a set of elevator control cables that ran vertically in close proximity to the railing.

TESTS AND RESEARCH

The slide and its associated hardware were removed from the airplane and shipped to the slide manufacturer for further examination and testing under the direct supervision of the NTSB.

The incident slide was inflated for a visual inspection. There was one BB-sized (0.177 inch diameter) hole in the left support tube with a 6-inch scrape leading to the hole. Dark linear markings of a grease-like material were noted on the right tube of the slide consistent with contact to the elevator control cables. The inflation system components (lanyard, inflation cylinder, and inflation valve) were within design specifications. Alignment of the inflation valve trigger was rotated approximately 30 degrees from its nominal position. However, per the slide manufacturer, this position would not have affected the initiation of slide inflation. Examination of the slide did not reveal any anomalies that would have prevented its normal deployment.

Two deployment tests were conducted using an exemplar slide and slide cover. The first test simulated a properly installed slide, with the forward tie-down straps/brackets engaged to the floor fittings. Upon activation of the slide, the slide expanded internally and caused the base of the slide cover to deform upward. Both forward tie-down straps remained attached to their respective floor fittings and were taut. The slide cover did not rotate open. The slide pack contained air and was noticeably larger, but the valise had not been breached.

The second test simulated a slide with the forward tie-down straps left unsecured. When the inflation lanyard was released, the slide began to inflate and the slide cover immediately rotated on its aft hinge allowing the slide to expand, separate its primary restraint, and fully extend.

Examination showed that the slide must rotate about 90 degrees from its normal resting position to activate its inflation cylinder. The slide cover also released from its hinges as designed at a similar angle. A properly secured slide cover would not have allowed the slide to rotate enough to activate its inflation cylinder.

A pull force test was performed to determine how much force was required to release the floor retention brackets. The tailcone release lanyard was pulled in a direction similar to that which occurs during a normal slide deployment. The retention brackets yielded at a combined force of 22.8 lbs. According to Boeing, a functional test of the retention brackets is required at manufacture; however, there is no specific pull force requirement.

ADDITIONAL DATA/INFORMATION

The incident flight was a charter operation for a political candidate, his staff, reporters, and United States Secret Service (USSS) personnel. Since the last service check of the evacuation slide, the incident airplane had flown 3 flight legs with the political candidate aboard. The results of an internal USSS investigation relating to the security sweeps of the incident aircraft revealed that no USSS personnel or USSS support personnel interfered with or altered the aircraft's hardware or systems relating to the tailcone evacuation slide.

After the incident, the airline inspected their 11 airplane MD-80 fleet as scheduled. The inspections were performed between July 11 and July 25, 2008. No anomalies with the tailcone evacuation slides were noted during the inspections.

A query of the FAA's Service Difficulty Reporting (SDR) system found one similar incident on an

National Transportation Safety Board

FACTUAL REPORT**AVIATION**

NTSB ID: CHI08IA182

Occurrence Date: 07/07/2008

Occurrence Type: Incident


Narrative (Continued)


MD-81 in September 1991. According to the report, the captain reported the flight controls were stiff during a preflight inspection. Upon examination, maintenance personnel found the tailcone evacuation slide inflated within the tailcone without the aft bulkhead door being armed/activated. Further investigation could not decisively determine the cause of the inadvertent slide inflation. In the event, none of the slide components, including the slide cover, were damaged during the inflation. All of the related systems were properly rigged. The operator suspected the cause of the inadvertent slide inflation was due to an inadequately restrained evacuation slide cover.


According to Boeing, only one similar incident, occurring in July 2002, had been reported to the company. The incident involved an MD-82 operator that experienced an in-flight tailcone evacuation slide inflation after encountering severe turbulence. The tailcone remained attached to the aft-fuselage. The slide was subsequently punctured when it impinged on adjacent structure. The operator reported that one of the forward tie-down straps was torn from the evacuation slide cover. The slide cover hinge sustained minor damage. The slide cover was repaired and returned to service before Boeing had an opportunity to examine the components.

On October 8, 2008, the airline released Maintenance Alert Bulletin #10-08 describing the incident and findings from the investigation. The bulletin also noted that an additional step would be added to the MD-80 Service Check to ensure the security of the slide cover tie-down straps. On October 14, 2008, the airline released a revision to the work card for the general visual inspection (service check), which added specific language calling for an examination of the tie-down straps to ensure their proper installation and security.

Updated on Jul 9 2009 10:36AM

 National Transportation Safety Board FACTUAL REPORT AVIATION		NTSB ID: CHI08IA182				
		Occurrence Date: 07/07/2008				
		Occurrence Type: Incident				
Landing Facility/Approach Information						
Airport Name Chicago Midway International		Airport ID: KMDW	Airport Elevation 620 Ft. MSL	Runway Used 31C	Runway Length 6522	Runway Width 150
Runway Surface Type: Concrete						
Runway Surface Condition: Dry						
Approach/Arrival Flown:						
VFR Approach/Landing:						
Aircraft Information						
Aircraft Manufacturer MCDONNELL DOUGLAS		Model/Series MD-81		Serial Number 48030		
Airworthiness Certificate(s): Transport						
Landing Gear Type: Retractable - Tricycle						
Amateur Built Acft? No		Number of Seats: 89		Certified Max Gross Wt. 140000 LBS	Number of Engines: 2	
Engine Type: Turbo Fan		Engine Manufacturer: Pratt & Whitney		Model/Series: JT8D-217C	Rated Power: 20000 LBS	
- Aircraft Inspection Information						
Type of Last Inspection Continuous Airworthiness		Date of Last Inspection 06/2008	Time Since Last Inspection Hours		Airframe Total Time 46844 Hours	
- Emergency Locator Transmitter (ELT) Information						
ELT Installed?/Type No		ELT Operated?	ELT Aided in Locating Accident Site?			
Owner/Operator Information						
Registered Aircraft Owner Midwest Airlines, Inc.		Street Address 6744 South Howell Avenue				
		City Oak Creek		State WI	Zip Code 53154-1474	
Operator of Aircraft Midwest Airlines, Inc.		Street Address 6744 South Howell Avenue				
		City Oak Creek		State WI	Zip Code 53154-1474	
Operator Does Business As:				Operator Designator Code: MWEA		
- Type of U.S. Certificate(s) Held:						
Air Carrier Operating Certificate(s): Flag Carrier/Domestic						
Operating Certificate:			Operator Certificate:			
Regulation Flight Conducted Under: Part 121: Air Carrier						
Type of Flight Operation Conducted: Non-scheduled; Domestic; Passenger Only						
<div>FACTUAL REPORT - AVIATION</div> <div>Page 2</div>						

 National Transportation Safety Board FACTUAL REPORT AVIATION		NTSB ID: CHI08IA182																																																																																											
		Occurrence Date: 07/07/2008																																																																																											
		Occurrence Type: Incident																																																																																											
First Pilot Information																																																																																													
Name		City		State	Date of Birth	Age																																																																																							
On File		On File		On File	On File	50																																																																																							
Sex: M	Seat Occupied: Left	Occupational Pilot? Yes			Certificate Number: On File																																																																																								
Certificate(s): Airline Transport																																																																																													
Airplane Rating(s): Multi-engine Land; Single-engine Land																																																																																													
Rotorcraft/Glider/LTA: None																																																																																													
Instrument Rating(s): Airplane																																																																																													
Instructor Rating(s): Airplane Multi-engine; Airplane Single-engine; Instrument Airplane																																																																																													
Current Biennial Flight Review? 06/2008																																																																																													
Medical Cert.: Class 1		Medical Cert. Status: With Waivers/Limitations			Date of Last Medical Exam: 06/2008																																																																																								
<table border="1"> <thead> <tr> <th>- Flight Time Matrix</th> <th>All A/C</th> <th>This Make and Model</th> <th>Airplane Single Engine</th> <th>Airplane Multi-Engine</th> <th>Night</th> <th colspan="2">Instrument Actual Simulated</th> <th>Rotorcraft</th> <th>Glider</th> <th>Lighter Than Air</th> </tr> </thead> <tbody> <tr> <td>Total Time</td> <td>15014</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> <tr> <td>Pilot In Command(PIC)</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> <tr> <td>Instructor</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> <tr> <td>Instruction Received</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> <tr> <td>Last 90 Days</td> <td>200</td> <td>200</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> <tr> <td>Last 30 Days</td> <td>60</td> <td>60</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> <tr> <td>Last 24 Hours</td> <td>1</td> <td>1</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> </tbody> </table>						- Flight Time Matrix	All A/C	This Make and Model	Airplane Single Engine	Airplane Multi-Engine	Night	Instrument Actual Simulated		Rotorcraft	Glider	Lighter Than Air	Total Time	15014										Pilot In Command(PIC)											Instructor											Instruction Received											Last 90 Days	200	200									Last 30 Days	60	60									Last 24 Hours	1	1								
- Flight Time Matrix	All A/C	This Make and Model	Airplane Single Engine	Airplane Multi-Engine	Night	Instrument Actual Simulated		Rotorcraft	Glider	Lighter Than Air																																																																																			
Total Time	15014																																																																																												
Pilot In Command(PIC)																																																																																													
Instructor																																																																																													
Instruction Received																																																																																													
Last 90 Days	200	200																																																																																											
Last 30 Days	60	60																																																																																											
Last 24 Hours	1	1																																																																																											
Seatbelt Used? Yes		Shoulder Harness Used? Yes		Toxicology Performed? No		Second Pilot? Yes																																																																																							
Flight Plan/Itinerary																																																																																													
Type of Flight Plan Filed: IFR																																																																																													
Departure Point		State	Airport Identifier	Departure Time	Time Zone																																																																																								
Chicago		IL	KMDW	0845	CDT																																																																																								
Destination		State	Airport Identifier																																																																																										
Charlotte		NC	KCLT																																																																																										
Type of Clearance: IFR																																																																																													
Type of Airspace: Class B																																																																																													
Weather Information																																																																																													
Source of Wx Information:																																																																																													
Automated Report																																																																																													
<div>FACTUAL REPORT - AVIATION</div> <div>Page 3</div>																																																																																													

 National Transportation Safety Board FACTUAL REPORT AVIATION		NTSB ID: CHI08IA182			
		Occurrence Date: 07/07/2008			
		Occurrence Type: Incident			

Weather Information					
WOF ID	Observation Time	Time Zone	WOF Elevation	WOF Distance From Accident Site	Direction From Accident Site
KMDW	0851	CDT	620 Ft. MSL	NM	Deg. Mag.
Sky/Lowest Cloud Condition: Scattered			8500 Ft. AGL	Condition of Light: Day	
Lowest Ceiling: Broken		15000 Ft. AGL		Visibility: 10 SM	Altimeter: 29.95 "Hg
Temperature: 26 °C	Dew Point: 21 °C	Weather Conditions at Accident Site: Visual Conditions			
Wind Direction: 230		Wind Speed: 10		Wind Gusts: 15	
Visibility (RVR): Ft.		Visibility (RVV) SM			
Precip and/or Obscuration: No Obscuration; Moderate - In the Vicinity - Showers - Rain					

Accident Information					
Aircraft Damage: Minor		Aircraft Fire: None		Aircraft Explosion: None	

- Injury Summary Matrix	Fatal	Serious	Minor	None	TOTAL	
First Pilot				1	1	
Second Pilot				1	1	
Student Pilot						
Flight Instructor						
Check Pilot						
Flight Engineer						
Cabin Attendants				4	4	
Other Crew				2	2	
Passengers				43	43	
- TOTAL ABOARD -				51	51	
Other Ground						
- GRAND TOTAL -				51	51	

FACTUAL REPORT - AVIATION		Page 4
---------------------------	--	--------

National Transportation Safety Board

FACTUAL REPORT**AVIATION**

NTSB ID: CHI08IA182

Occurrence Date: 07/07/2008

Occurrence Type: Incident

Administrative Information

Investigator-In-Charge (IIC)

Andrew T. Fox

Additional Persons Participating in This Accident/Incident Investigation:

David Keenan
Federal Aviation Administration, AAI-100
Washington, DC

Chris White
Midwest Airlines
Milwaukee, WI

Richard Anderson
Boeing
Renton, WA

George Yribarren
Goodrich
Phoenix, AZ

United States Secret Service
Chicago, IL